

## Status Report on Breakdowns (Urban / Rural)

Urban

S.No	Circle	No.of Feeders Existing Urban		Breakdowns occurred during the day		Attended during the day		Time taken for restoring the supply				Remarks (Pending)
		33KV	11KV	33KV	11KV	33KV	11KV	Rectified (Within 24 Hours)		Not Rectified (Above 24 Hours)		
								33KV	11KV	33KV	11KV	
1	MBN	18	107									
2	NLG	22	358									
3	MDK	97	359									
4	SDPT											
5	RR(S)	53	234									
6	RR(N)	54	550									
7	RR(E)	168	403									
8	Hyd	194	1044									
	<b>Total</b>	<b>606</b>	<b>3055</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>0</b>	

Rural

S.No	Circle	No.of Feeders Existing Rurals		Breakdowns occurred during the day		Attended during the day		Time taken for restoring the supply				Remarks (Pending)
		33KV	11KV	33KV	11KV	33KV	11KV	Rectified (Within 24 Hours)		Not Rectified (Above 24 Hours)		
								33KV	11KV	33KV	11KV	
1	MBN	107	849	4		4		4				
2	NLG	144	988		4		4		4			
3	MDK	107	933									
4	SDPT											
5	RR(S)	58	396									
6	RR(N)	38	114									
7	RR(E)	22	133									
	<b>Total</b>	<b>476</b>	<b>3413</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>0</b>	<b>0</b>	
	<b>Grand Total</b>	<b>1082</b>	<b>6468</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>4</b>	<b>0</b>	<b>0</b>	

## TSSPDCL - LMRC / Corporate office

Date: 30.09.2018

S.No	Circle	Name of 33/11KV SS	Name of 11 KV Feeder	Vol	Name of the Division	From	To	Duration	Relay Indication	Cause of Breakdown	Alternate Supply Arranged
1	NLG	Dirsincherla	Yellapuram	11KV	Huzurnagar	17.40	19.30	01.50	EL	Due 11Kv jumper cutted	-
2		Mushmapally	Muthyalamma Feeder	11KV	Nalgonda	07.00	08.40	01.40	EL	11KV lline Jumper Cut	-
3		Urumadla	Yellikatte	11KV	Nalgonda	10.00	11.00	01.00	EL	AB switch Female Cut	-
4		Cheedella	Gajula Malkapuram	11KV	Suryapet	13.40	15.40	02.00	E/L	Bird fallen on the line	-

TSSPDCL - LMRC / Corporate office

Date: 30.09.2018

S.No	Circle	Name of 132/33KV SS	Name of 33 KV Feeder	Vol	Name of the Division	From	To	Duration	Relay Indication	Cause of Breakdown	Sub Stations Effected	Alternate Supply Arranged
1	MBNR	Wanaparthy	Buddaram	33kv	Wanaparthy	14.33	18.40	04.07	E/L	Due to Cross Arm Bend & Touched to Iron Pole	Buddaram	-
2		Wanaparthy	Gopalpet	33kv	Wanaparthy	14.20	18.40	04.20	E/L&O/L	Insulator Failed at St.Thomas School Wanaparthy	Gopalpet	-
3		Thirumalaipally	Kurumurthy	33kv	Wanaparthy	19.34	22.25	02.51	E/L	33KV Insuator Failed near Bausum Thanda at Kothapally	Kurumurthy	-
4		Gadwal	Alwalpad	33kv	Gadwal	21.06	00.05	02.59	E/L	Due to Rain and AB Switch Problem at Jampally Village	Alwalpad	-